

NHTSA Recalls of Interest January 23, 2012

Report Date :January 23, 2012 at 09:57 AM NHTSA CAMPAIGN ID Number:12V014000

Vehicle Make / Model:

KIA / OPTIMA KIA / RONDO

Manufacturer: KIA MOTORS CORPORATION NHTSA CAMPAIGN ID Number: 12V014000

Component: AIR BAGS:FRONTAL

Potential Number of Units Affected: 145,755

Summary:

Model Year(s): 2006-2008 2007-2008

Mfr's Report Date: JAN 13, 2012 NHTSA Action Number: N/A

KIA MOTORS AMERICA, INC. (KIA) IS RECALLING CERTAIN MODEL YEAR 2006-2008 KIA OPTIMA VEHICLES MANUFACTURED FROM SEPTEMBER 29, 2005, THROUGH JANUARY 29, 2008, AND MODEL YEAR 2007 AND 2008 KIA RONDO VEHICLES MANUFACTURED FROM SEPTEMBER 13, 2006, THROUGH MARCH 21, 2008. THE CLOCK SPRING CONTACT ASSEMBLY FOR THE DRIVER'S SIDE AIR BAG SUPPLEMENTAL RESTRAINT SYSTEM (SRS) MAY BECOME DAMAGED THROUGH USAGE OVER TIME. IF THE CLOCK SPRING CONTACT ASSEMBLY BECOMES DAMAGED, THE DRIVER'S AIR BAG ELECTRICAL CIRCUIT WILL EXPERIENCE A HIGH RESISTANCE CONDITION POTENTIALLY CAUSING THE DRIVER'S AIR BAG TO NOT DEPLOY.

Consequence:

IF THE CLOCK SPRING DEVELOPS HIGH RESISTANCE, IN THE EVENT OF A CRASH, THE DRIVERS AIR BAG WILL NOT DEPLOY AND WILL NOT BE ABLE TO PROPERLY PROTECT THE DRIVER, INCREASING THE RISK OF INJURIES.

Remedy:

KIA WILL NOTIFY OWNERS, AND DEALERS WILL REPLACE THE VEHICLE'S AIR BAG CLOCK SPRING CONTACT ASSEMBLY AS NECESSARY, FREE OF CHARGE. THE SAFETY RECALL IS EXPECTED TO BEGIN DURING MARCH 2012. OWNERS MAY CONTACT KIA CUSTOMER ASSISTANCE CENTER AT 1-800-333-4542.

Notes:

KIA'S RECALL CAMPAIGN NUMBER IS SC094. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO $\underline{\mathsf{HTTP://WWW.SAFERCAR.GOV}}$.

Report Date :January 23, 2012 at 09:59 AM NHTSA CAMPAIGN ID Number:12V010000

Vehicle Make / Model: Model Year(s):

FCCC / S2 106 CH 2012

Manufacturer: DAIMLER TRUCKS NORTH AMERICA
NHTSA CAMPAIGN ID Number: 12V010000

Mfr's Report Date: DEC 22, 2011
NHTSA Action Number: N/A

Component: EXTERIOR LIGHTING:TURN SIGNAL

Potential Number of Units Affected: 60

Summary:

DAIMLER TRUCKS (DTNA) IS RECALLING CERTAIN MODEL YEAR 2012 FREIGHTLINER CUSTOM CHASSIS (FCC) MODEL S2 106 CH INCOMPLETE VEHICLES, MANUFACTURED FROM FEBRUARY 24, 2011, THROUGH AUGUST 3, 2011. DUE TO A VEHICLE SOFTWARE ISSUE, THE SIDE MARKER/DIRECTIONAL LIGHTS TO STOP FUNCTIONING AFTER 5 TO 13 MINUTES OF VEHICLE OPERATION.

Consequence:

FAILURE OF THE SIDE MARKER/DIRECTIONAL LIGHTS TO ILLUMINATE WILL RESULT IN DECREASED VISIBILITY OF THE VEHICLE AND/OR MISINFORM OTHER DRIVERS AS TO THE INTENDED DIRECTION OF TRAVEL, EITHER OF WHICH COULD INCREASE THE RISK OF A CRASH.

Remedy:

DTNA WILL NOTIFY OWNERS, AND THE BULK-HEAD MODULE SOFTWARE WILL BE UPDATED BY DTNA AUTHORIZED SERVICE FACILITIES, FREE OF CHARGE. THE SAFETY RECALL IS EXPECTED TO BEGIN ON OR ABOUT FEBRUARY 1, 2012. OWNERS MAY CONTACT DTNA AT 1-800-547-0712.

Notes:

THIS RECALL IS RELATED TO RECALL 11V-578. DAIMLER TRUCKS SAFETY RECALL NUMBER IS FL-620. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO HTTP://www.safercar.gov.