



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

May 6, 2024

Driver's Front Air Bag May Tear

An air bag that does not deploy as intended increases the risk of injury during a crash.

NHTSA Campaign Number: 24V311000

Manufacturer General Motors, LLC

Components AIR BAGS

Potential Number of Units Affected 74

Summary

General Motors, LLC (GM) is recalling certain 2024 Cadillac XT5 vehicles. The driver's front air bag cushion may tear during deployment, resulting in the air bag not deploying as intended.

Remedy

Dealers will replace the driver's front air bag module, free of charge. Owner notification letters are expected to be mailed June 17, 2024. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is N232439241.

Vehicle

MAKE	MODEL	YEAR
CADILLAC	XT5	2024

EGR Valve May Short and Cause Loss of Drive Power

A loss of drive power increases the risk of a crash.

NHTSA Campaign Number: 24V308000

Manufacturer Hyundai Motor America

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 13,511

Summary

Hyundai Motor America (Hyundai) is recalling certain 2024 Elantra, Venue, and Kona vehicles. An electrical short circuit may occur in the exhaust gas recirculation (EGR) valve assembly, which can result in a loss of drive power.

Remedy

Dealers will replace the exhaust gas recirculation valve assembly, free of charge. Owner notification letters are expected to be mailed June 28, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 260.

Vehicles

MAKE	MODEL	YEAR
HYUNDAI	ELANTRA	2024
HYUNDAI	KONA	2024
HYUNDAI	VENUE	2024

Fuel Line Sensor Housing May Leak

A fuel leak may cause an engine stall, increasing the risk of a crash. A fuel leak in the presence of an ignition source can increase the risk of a fire.

NHTSA Campaign Number: 24V306000

Manufacturer Chrysler (FCA US, LLC)

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 261

Summary

Chrysler (FCA US, LLC) (Stellantis) is recalling certain 2021 Alfa Romero Giulia vehicles. The fuel line sensor housing may crack and leak fuel.

Remedy

Dealers will replace the fuel line sensor housing, free of charge. Owner notification letters are expected to be mailed June 19, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 54B. This recall is an expansion of recall number 21V-878.

Vehicle

MAKE	MODEL	YEAR
ALFA ROMEO	GIULIA	2021

Incorrectly Installed Driveshaft

An unexpected loss of drive power can increase the risk of a crash.

NHTSA Campaign Number: 24V304000

Manufacturer Nissan North America, Inc.

Components POWER TRAIN

Potential Number of Units Affected 9,645

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2024 Sentra vehicles. The front left-side driveshaft may not be fully seated in the continuously variable transmission (CVT) assembly, or may have a loose or missing retaining clip, which can cause a transmission fluid leak and loss of drive power.

Remedy

Dealers will inspect the front left driveshaft, and if necessary, replace the driveshaft and CVT assembly, free of charge. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PMA37.

Vehicle

MAKE	MODEL	YEAR
NISSAN	SENTRA	2024

High Voltage Battery Damage from Water Intrusion

A high voltage battery with water damage can cause a fire or a vehicle stall, increasing the risk of injury or a crash.

NHTSA Campaign Number: 24V302000

Manufacturer BMW of North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 128

Summary

BMW of North America, LLC (BMW) is recalling certain 2021-2023 MINI Hardtop 2 Door (Cooper SE) vehicles. The high voltage battery housing may not have been sealed properly, allowing water to enter the battery.

Remedy

Dealers will inspect and leak test the high voltage battery, and repair the battery as necessary, free of charge. Owner notification letters are expected to be mailed June 21, 2024. Owners may contact BMW customer service at 1-866-825-1525.

Vehicle

MAKE	MODEL	YEAR
MINI	COOPER SE	2021-2023

Brake Booster Corrosion May Impair Braking

Reduced brake performance or brake failure can increase the risk of a crash.

NHTSA Campaign Number: 24V298000

Manufacturer Mercedes-Benz USA, LLC

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 15,604

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2006-2012 ML, GL, and R-Class vehicles. Please refer to MBUSA's recall report for specific vehicle model details. Moisture may accumulate and cause corrosion in the brake booster housing unit, which can result in reduced brake performance or brake failure.

Remedy

Owners are advised not to drive their vehicles until the remedy has been performed. Dealers will remove the rubber sleeve, inspect the brake booster, and as necessary, replace the brake booster. All repairs will be

performed free of charge. Owner notification letters are expected to be mailed May 17, 2024. Owners may contact MBUSA customer service at 1-800-367-6372. MMUSA's number for this recall is 2024MMNNNN. This recall is an expansion of previous recall number 22V-315.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	AMG R63	2007
MERCEDES BENZ	GL320	2007-2009
MERCEDES BENZ	GL350	2009-2012
MERCEDES BENZ	GL450	2007-2012
MERCEDES BENZ	GL550	2008-2012
MERCEDES BENZ	ML320	2007-2009
MERCEDES BENZ	ML350	2006-2011
MERCEDES BENZ	ML450	2010-2011
MERCEDES BENZ	ML500	2006-2008
MERCEDES BENZ	ML550	2008-2011
MERCEDES BENZ	R320	2007-2009
MERCEDES BENZ	R500	2006-2007
MERCEDES-BENZ	AMG ML63	2007-2011

MAKE	MODEL	YEAR
MERCEDES-BENZ	R350	2006-2012

Panoramic Roof Panel May Detach from Vehicle

A roof panel that detaches while driving can create a road hazard and increase the risk of a crash.

NHTSA Campaign Number: 24V294000

Manufacturer Ford Motor Company

Components VISIBILITY

Potential Number of Units Affected 1,315

Summary

Ford Motor Company (Ford) is recalling certain 2017-2019 Transit Connect vehicles. An improper bond may exist between the panoramic roof and the vehicle body, which can result in the panel detaching from the vehicle.

Remedy

Dealers will remove, clean, and reinstall the panoramic roof panel, free of charge. Owner notification letters are expected to be mailed May 20, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 24S29.

Vehicle

MAKE	MODEL	YEAR
FORD	TRANSIT CONNECT	2017-2019

Tail Lights May Fail

Rear tail lights that fail to illuminate can reduce the vehicle's visibility to other drivers, increasing the risk of a crash.

NHTSA Campaign Number: 24V293000

Manufacturer Ford Motor Company

Components EXTERIOR LIGHTING, ELECTRICAL SYSTEM

Potential Number of Units Affected 242,669

Summary

Ford Motor Company (Ford) is recalling certain 2022-2024 Maverick vehicles. The Body Control Module (BCM) may inadvertently deactivate one or both rear tail lights.

Remedy

Dealers will update the BCM software, free of charge. Owner notification letters are expected to be mailed May 20, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 24S24.

Vehicle

MAKE	MODEL	YEAR
FORD	MAVERICK	2022-2024
