



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

June 17, 2024

Side Curtain Air Bags May Not Deploy Properly

Damaged pillar trim panel clips can result in improper side curtain air bag deployment, increasing the risk of injury during a crash.

NHTSA Campaign Number: 24V408000

Manufacturer Rivian Automotive, LLC

Components AIR BAGS

Potential Number of Units Affected 1,723

Summary

Rivian Automotive, LLC (Rivian) is recalling certain 2022-2024 R1T and R1S vehicles. The attachment clips on the upper B-pillar and/or C-pillar trim panels may have been damaged during a service procedure.

Remedy

Rivian will replace the pillar trim panels, free of charge. Owner notification letters are expected to be mailed July 26, 2024. Owners may contact Rivian customer service at 1-888-748-4261. Rivian's number for this recall is FSAM 1464.

Vehicles

MAKE	MODEL	YEAR
RIVIAN	R1S	2022-2024

MAKE	MODEL	YEAR
RIVIAN	R1T	2022-2024

Loss of Power Steering Assist

A loss of power steering assist can increase the risk of a crash.

NHTSA Campaign Number: 24V412000

Manufacturer Hyundai Motor America

Components STEERING

Potential Number of Units Affected 795

Summary

Hyundai Motor America (Hyundai) is recalling certain 2024 Tucson and Santa Cruz vehicles. The circuit board in the motor-driven power steering assembly may short circuit, resulting in a loss of power steering assist.

Remedy

Dealers will replace the motor-driven power steering electric power pack, free of charge. Owner notification letters are expected to be mailed August 3, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 261.

Vehicles

MAKE	MODEL	YEAR
HYUNDAI	SANTA CRUZ	2024
HYUNDAI	TUCSON	2024

Loss of Power Steering Assist

A loss of power steering assist can increase the risk of a crash.

NHTSA Campaign Number: 24V422000

Manufacturer Kia America, Inc.

Components STEERING

Potential Number of Units Affected 1,075

Summary

Kia America, Inc. (Kia) is recalling certain 2024 Kia Sportage vehicles. The circuit board in the motor-driven power steering assembly may short circuit, resulting in a loss of power steering assist.

Remedy

Dealers will replace the motor-driven power steering electric power pack, free of charge. Owner notification letters are expected to be mailed August 6, 2024. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC319.

Vehicle

MAKE	MODEL	YEAR
KIA	SPORTAGE	2024

Inaccessible Front Seat Belts

An inaccessible seat belt that cannot restrain an occupant, increases the risk of injury in a crash.

NHTSA Campaign Number: 24V418000

Manufacturer General Motors, LLC

Components SEAT BELTS

Potential Number of Units Affected 13,464

Summary

General Motors, LLC (GM) is recalling certain 2024-2025 Chevrolet Corvette vehicles. The driver and/or passenger seat belt retractors may lock in a stowed position and become inaccessible to occupants.

Remedy

Dealers will replace the driver and/or passenger seat belt retractors, free of charge. Owner notification letters are expected to be mailed July 22, 2024. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N242441390.

Vehicle

MAKE	MODEL	YEAR
CHEVROLET	CORVETTE	2024-2025

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera image that does not display decreases the driver's visibility, increasing the risk of a crash.

NHTSA Campaign Number: 24V437000

Manufacturer Chrysler (FCA US, LLC)

Components BACK OVER PREVENTION

Potential Number of Units Affected 1

Summary

Chrysler (FCA US, LLC) is recalling one 2022 Ram 1500 Classic vehicle. The wiring harness may short circuit and prevent the rearview image from displaying. As such, this vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will replace the wiring harness, free of charge. The vehicle has been remedied. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 65B.

Vehicle

MAKE	MODEL	YEAR
RAM	1500	2022

Insufficient Barrier Performance/FMVSS 222

An insufficient restraining barrier can increase the risk of injury in a crash.

NHTSA Campaign Number: 24V429000

Manufacturer Forest River Bus, LLC

Components STRUCTURE

Potential Number of Units Affected 3,192

Summary

Forest River Bus, LLC (Forest River) is recalling certain 2013-2016 Starcraft Allstar MVP, 2016 and 2019 Allstar XL, 2016-2018 Allstar XL MVP, 2009-2010 and 2012-2018 Starcraft MFSAB/Prodigy, 2014-2016 Quest XL, 2013 and 2015-2018 Starcraft MPV/Prodigy, 2009-2010 Prodigy, 2009-2022 Quest, 2011 Quest XL school buses. The restraining barrier may not provide sufficient protection in a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection."

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed July 10, 2024. Owners may contact Forest River customer service at 1-800-348-7440. recall is 05-1584.

Vehicles

MAKE	MODEL	YEAR
FOREST RIVER BUS	STARCRAFT MFSAB/PRODIGY	2009-2010, 2012
Forest River Bus	STARCRAFT ALL STAR XL	2016, 2019
Forest River Bus	STARCRAFT ALLSTAR MPV	2013-2016
Forest River Bus	STARCRAFT ALLSTAR XL MVP	2016-2018
Forest River Bus	STARCRAFT MFSAB/PRODIGY	2013-2018
Forest River Bus	STARCRAFT MPV/PRODIGY BUS	2013, 2015-2018
STARCRAFT BUS	PRODIGY	2009-2010
STARCRAFT BUS	QUEST	2009-2022
STARCRAFT BUS	QUEST XL	2011, 2014-2016

Incorrectly Displayed Warning Lights/FMVSS 135,101

Warning lights that do not display correctly can fail to alert the driver to critical safety information, increasing the risk of a crash or injury.

NHTSA Campaign Number: 24V405000

Manufacturer Fisker Group Inc

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 6,864

Summary

Fisker Group Inc (Fisker) is recalling all 2023 Ocean vehicles. The instrument panel displays the incorrect font size of the Brake, Park, and Antilock Brake System (ABS) warning lights, and displays certain warning lights in amber instead of red. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 135, "Light Vehicle Brake Systems" and 101, "Controls and Displays." Additionally, multiple warning lights fail to illuminate during the ignition cycle bulb check, failing to comply with the requirements of FMVSS 138 and 208.

Remedy

Fisker will release an over-the-air (OTA) software update, free of charge. Owner notification letters were mailed June 11, 2024. Owners may contact Fisker customer service at 1-844-347-5371. Fisker's number for this recall is TSB70062404.

Vehicle

MAKE	MODEL	YEAR
FIKSKER	OCEAN	2023

Loss of Drive Power

A loss of drive power increases the risk of a crash.

NHTSA Campaign Number: 24V404000

Manufacturer Fisker Group Inc

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 6,864

Summary

Fisker Group Inc (Fisker) is recalling all 2023 Ocean vehicles. The Motor Control Unit (MCU) and Vehicle Control Unit (VCU) software may cause the vehicle to enter a safe state protection mode unexpectedly, causing a loss of drive power.

Remedy

Fisker will release an over-the-air (OTA) update to the MCU and VCU software, free of charge. Owner notification letters are expected to be mailed June 30, 2024. Owners may contact Fisker customer service at 1-844-347-5371. Fisker's number for this recall is TSB10032403.

Vehicle

MAKE	MODEL	YEAR
FIKSKER	OCEAN	2023

Improperly Tightened Seat Belt Bolt/FMVSS 210

An improperly secured seat belt buckle may not properly restrain occupants during a crash, increasing the risk of injury.

NHTSA Campaign Number: 24V434000

Manufacturer Chrysler (FCA US, LLC)

Components SEAT BELTS

Potential Number of Units Affected 53

Summary

Chrysler (FCA US, LLC) is recalling certain 2023 Jeep Grand Cherokee vehicles. A bolt for the second-row seat belt buckle may not be tightened properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 210, "Seat Belt Assembly Anchorages."

Remedy

Dealers will inspect and tighten the second-row seat buckle bolt as necessary, free of charge. Owner notification letters are expecting to be mailed August 2, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 70B.

Vehicle

MAKE	MODEL	YEAR
JEEP	GRAND CHEROKEE	2023

Over-Tightened Brake Line May Fail

Reduced braking ability can cause longer brake pedal travel or extend the distance required to stop the vehicle, increasing the risk of a crash.

NHTSA Campaign Number: 24V428000

Manufacturer Volkswagen Group of America, Inc.

Components SERVICE BRAKES, AIR

Potential Number of Units Affected 65

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2024 Audi Q8 Sportback E-Tron Quattro and Q8 E-Tron Quattro vehicles. The brake line connection may have been over-tightened and fail, resulting in a brake fluid leak and reduced braking ability.

Remedy

Dealers will inspect and replace the brake pressure line as necessary, free of charge. Owner notification letters are expected to be mailed on August 9, 2024. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 47DE.

Vehicles

MAKE	MODEL	YEAR
AUDI	Q8 E-TRON	2024
AUDI	Q8 SPORTBACK E-TRON	2024

Loss of Steering Control from Tie Rod Failure

A sudden loss of steering control increases the risk of a crash.

NHTSA Campaign Number: 24V424000

Manufacturer Mack Trucks, Inc.

Components POWER TRAIN, STEERING

Potential Number of Units Affected 7

Summary

Mack Trucks, Inc. (Mack) is recalling certain 2025 Anthem and Pinnacle trucks. The tie rod assemblies may contain an improperly heat-treated ball stud that can fail, resulting in a sudden loss of steering control.

Remedy

Owners are advised not to drive their vehicles until the remedy has been completed. Dealers will inspect and replace the tie rod ends as necessary, free of charge. Owner notification letters are expected to be mailed July 5, 2024. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0466.

Vehicles

MAKE	MODEL	YEAR
MACK	ANTHEM (AN)	2025
MACK	PINNACLE (PI/PN)	2025

Loss of Steering Control from Tie Rod Failure

A sudden loss of steering control increases the risk of a crash.

NHTSA Campaign Number: 24V423000

Manufacturer Volvo Trucks North America

Components STEERING

Potential Number of Units Affected 3

Summary

Volvo Trucks North America (Volvo Trucks) is recalling certain 2025 VN trucks. The tie rod assemblies may contain an improperly heat-treated ball stud that can fail, resulting in a sudden loss of steering control.

Remedy

Owners are advised not to drive their vehicles until the remedy has been completed. Dealers will inspect and replace the tie rod ends as necessary, free of charge. Owner notification letters are expected to be mailed July 5, 2024. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Truck's number for this recall is RVXX2404.

Vehicle

MAKE	MODEL	YEAR
VOLVO	VN	2025

Inoperative Trailer Lighting/FMVSS 108

Trailer taillights and turn signal lights that do not illuminate as intended can increase the risk of a crash.

NHTSA Campaign Number: 24V414000

Manufacturer Chrysler (FCA US, LLC)

Components EXTERIOR LIGHTING

Potential Number of Units Affected 4

Summary

Chrysler (FCA US, LLC) is recalling certain 2024 Jeep Wrangler vehicles. The power distribution center may prevent the trailer turn signal lights and taillights from operating as intended. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Dealers will replace the power distribution center, free of charge. Owner notification letters are expecting to be mailed July 26, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 57B.

Vehicle

MAKE	MODEL	YEAR
JEEP	WRANGLER	2024
