



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

October 21, 2024

Roof Rail Air Bag Inflator End Cap May Detach

A separated inflator end cap or inflator rupture can allow compressed gas to escape, resulting in the end cap or other components being propelled into the vehicle, increasing the risk of injury or crash.

NHTSA Campaign Number: 24V756000

Manufacturer General Motors, LLC

Components AIR BAGS

Potential Number of Units Affected 2,061

Summary

General Motors, LLC (GM) is recalling certain 2018 Chevrolet Silverado 1500, GMC Sierra 1500, 2018-2019 Chevrolet Silverado 2500, 3500, and GMC Sierra 2500, 3500 Crew Cab trucks. The left or right-side roof-rail air bag (RRAB) inflator end cap may detach from the inflator or the inflator sidewall may rupture.

Remedy

Dealers will replace the left and right side RRAB modules, free of charge. Owner notification letters are expected to be mailed November 25, 2024. Owners may contact Chevrolet customer service at 1-800-222-1020, and GMC Customer Service at 888-988-7267. GM's number for this recall is N242474500.

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO 1500	2018

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO 2500	2018-2019
CHEVROLET	SILVERADO 3500	2018-2019
GMC	SIERRA 1500	2018
GMC	SIERRA 2500	2018-2019
GMC	SIERRA 3500	2018-2019

Turn Signals May Not Be Visible/FMVSS 108

Front turn signals that are difficult to see may not clearly indicate the driver's intentions to other road users, increasing the risk of a crash.

NHTSA Campaign Number: 24V755000

Manufacturer General Motors, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 1,962

Summary

General Motors, LLC (GM) is recalling certain 2024 GMC Sierra EV vehicles. The front turn signal lights and parking lights may be too similar in brightness, making it difficult to see the front turn signals when they are activated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Dealers will replace the headlamp multipurpose LED driver (MLD) module, free of charge. Owner notification letters are expected to be mailed November 25, 2024. Owners may contact GMC customer service at 888-988-7267. GM's number for this recall is N242474560.

Vehicle

MAKE	MODEL	YEAR
GMC	SIERRA EV	2024

Blank Instrument Panel Screen/FMVSS 101

An instrument panel screen that fails to display critical safety information, such as the speedometer or warning lights, can increase the risk of a crash.

NHTSA Campaign Number: 24V757000

Manufacturer Kia America, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 14,163

Summary

Kia America, Inc. (Kia) is recalling certain 2024-2025 EV9 vehicles. Due to a software error, the instrument panel screen may fail. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Controls and Displays."

Remedy

The instrument cluster software will be updated by a dealer or through an over-the-air (OTA) update, free of charge. Owner notification letters are expected to be mailed October 31, 2024. Owners may contact Kia Customer Service at 1-800-333-4542. Kia's number for this recall is SC326.

Vehicle

MAKE	MODEL	YEAR
KIA	EV9	2024-2025

Vehicle Fire when Parked

A vehicle fire increases the risk of injury.

NHTSA Campaign Number: 24V761000

Manufacturer Hyundai Motor America

Components FUEL SYSTEM, OTHER, FUEL/PROPULSION SYSTEM

Potential Number of Units Affected 1,545

Summary

Hyundai Motor America (Hyundai) is recalling certain 2019-2024 Nexo vehicles. The thermally activated pressure relief device (TPRD) may break and cause a hydrogen gas leak, which can result in a fire while parked.

Remedy

Owners are advised to park outside and away from structures until the recall remedy is completed. Dealers will replace the TPRD, free of charge. Owner notification letters are expected to be mailed December 10,

2024. Owners may contact Hyundai Customer Service at 800-633-5151. Hyundai's number for this recall is 269.

Vehicle

MAKE	MODEL	YEAR
HYUNDAI	NEXO	2019-2024

Interior Rear Cargo Rail May Detach in Crash

Interior rear cargo rail detachment during a crash can increase the risk of injury.

NHTSA Campaign Number: 24V764000

Manufacturer BMW of North America, LLC

Components STRUCTURE

Potential Number of Units Affected 8,725

Summary

BMW of North America, LLC (BMW) is recalling certain 2018-2022 X3 sDrive30i, X3 xDrive30i, X3 M40i, and X3 M vehicles. The attachment for the rear cargo rail may become damaged in a rear crash and result in the cargo rail detaching.

Remedy

Dealers will replace the rear cargo rail attachment bolts, free of charge. Owner notification letters are expected to be mailed December 6, 2024. Owners may contact BMW customer service at 1-800-525-7417. Vehicles in this recall were previously remedied for this issue under recall number 24V-534 and will need to have the new repair completed.

Vehicle

MAKE	MODEL	YEAR
BMW	X3	2018-2022

Brake Caliper May Detach

A detached brake caliper can cause a loss of braking ability, increasing the risk of a crash.

NHTSA Campaign Number: 24V750000

Manufacturer Navistar, Inc.

Components SERVICE BRAKES, AIR

Potential Number of Units Affected 1,216

Summary

Navistar, Inc. (Navistar) is recalling certain 2024-2025 IC Bus EVSB and 2024-2025 CESB school buses. The brake caliper mounting bolts may not have been properly tightened, allowing the brake caliper to detach from the anchor plate.

Remedy

Navistar will inspect, tighten, and replace any missing bolts as necessary, free of charge. Owner notification letters are expected to be mailed November 22, 2024. Owners may contact Navistar Customer Service at 800-448-7825. Navistar's number for this recall is 24513.

Vehicles

MAKE	MODEL	YEAR
IC BUS	CESB	2024-2025
IC BUS	EVSB	2024-2025

Windshield Wipers May Fail

Inoperative windshield wipers can reduce visibility, increasing the risk of a crash.

NHTSA Campaign Number: 24V765000

Manufacturer Lamborghini (Automobili Lamborghini)

Components VISIBILITY

Potential Number of Units Affected 455

Summary

Lamborghini (Automobili Lamborghini) is recalling certain 2024 Revuelto vehicles. The connecting rod between the passenger wiper arm and the wiper motor may bend and separate from the wiper motor, causing the wipers to fail.

Remedy

Dealers will replace the passenger wiper system connecting rod, free of charge. Owner notification letters are expected to be mailed December 8, 2024. Owners may contact Automobili Lamborghini customer service at 1-866-681-6276. Automobili Lamborghini's number for this recall is L74X-R.02.24.

Vehicle

MAKE	MODEL	YEAR
LAMBORGHINI	REVUELTO	2024

Brake Pedal Failure

A loss of brake function increases the risk of a crash.

NHTSA Campaign Number: 24V752000

Manufacturer Chrysler (FCA US, LLC)

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 21,069

Summary

Chrysler (FCA US, LLC) is recalling certain 2024-2025 Dodge Hornet and Alfa Romeo Tonale vehicles. The brake pedal may collapse and cause a loss of brake function.

Remedy

Dealers will reinforce the brake pedal arm, free of charge. Owner notification letters are expected to be mailed October 24, 2024. Owners may contact FCA Customer Service at 1-800-853-1403. FCA's number for this recall is B7B.

Vehicles

MAKE	MODEL	YEAR
ALFA ROMEO	TONALE	2024-2025
DODGE	HORNET	2024-2025
