

NHTSA Recalls of Interest February 3, 2025

Missing ABS Function for Trailer/FMVSS 121

Driving without a functioning anti-lock brake system may result in the trailer not braking as intended, increasing the risk of a crash.

NHTSA Campaign Number: 25V030000

Manufacturer Mack Trucks, Inc.

Components SERVICE BRAKES, AIR

Potential Number of Units Affected 142

Summary

Mack Trucks, Inc. (Mack) is recalling certain 2010-2018 MRU and 2019-2025 Terrapro towing vehicles. The vehicles are missing the anti-lock brake (ABS) warning light and circuitry that controls the anti-lock brake function for an attached trailer. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems."

Remedy

Dealers will add an ABS warning light and circuitry, free of charge. Owner notification letters are expected to be mailed March 21, 2025. Owners may contact Mack's customer service at 1-800-866-1177. Mack's number for this recall is SC0474.

MAKE	MODEL	YEAR
MACK	MRU	2010-2018

MAKE	MODEL	YEAR
MACK	TERRAPRO (TE)	2019-2025

Steering Gear Assembled Incorrectly

A fractured steering gear can cause the steering to bind or lock, resulting in a loss of steering control and increasing the risk of a crash.

NHTSA Campaign Number: 25V022000

Manufacturer Ford Motor Company

Components STEERING

Potential Number of Units Affected 3

Summary

Ford Motor Company (Ford) is recalling certain 2024 F-150 vehicles. The steering gear assembly may have been assembled with an incorrect rack, which can cause the gears to fracture.

Remedy

Dealers will replace the steering gear assembly, free of charge. Owner notification letters are expected to be mailed February 10, 2025. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 25S04.

Vehicle

MAKE	MODEL	YEAR
FORD	F-150	2024

Incorrect Maximum Tire Pressure/FMVSS 139

Tires inflated to an incorrect maximum pressure may have insufficient strength, allowing the tires to fail and increasing the risk of a crash.

NHTSA Campaign Number: 25V023000

Manufacturer Mercedes-Benz USA, LLC

Components TIRES

Potential Number of Units Affected 165

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 E 400 Cabriolet, E 400 Coupe, 2019 E 450 Cabriolet, and E 450 Coupe vehicles. The tires were incorrectly marked with the wrong maximum inflation pressure and may not meet the strength requirements for the stated pressure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles."

Remedy

Dealers will inspect and replace the tires as necessary, free of charge. Owner notification letters are expected to be mailed March 18, 2025. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	E 400	2018
MERCEDES-BENZ	E 450	2019

Engine Stall from Software Error

An engine stall or loss of power can increase the risk of a crash or injury.

NHTSA Campaign Number: 25V031000

Manufacturer Honda (American Honda Motor Co.)

Components FUEL SYSTEM, GASOLINE, ELECTRICAL SYSTEM

Potential Number of Units Affected 294,612

Summary

Honda (American Honda Motor Co.) is recalling certain 2022-2025 Acura MDX Type-S, 2023-2025 Honda Pilot, and 2021-2025 Acura TLX Type-S vehicles. A software error in the fuel injection electronic control unit (FI-ECU) may cause an engine stall or a loss of power.

Remedy

Dealers will reprogram the FI-ECU software, free of charge. Owner notification letters are expected to be mailed March 17, 2025. Owners may contact Honda's customer service at 1-888-234-2138. Honda's numbers for this recall are EL1 and AL0.

MAKE	MODEL	YEAR
ACURA	MDX TYPE S	2022-2025

MAKE	MODEL	YEAR
ACURA	TLX TYPE S	2021-2025
HONDA	PILOT	2023-2025

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera that does not display an image can reduce the driver's rear view, increasing the risk of a crash.

NHTSA Campaign Number: 25V032000

Manufacturer Honda (American Honda Motor Co.)

Components BACK OVER PREVENTION, EQUIPMENT

Potential Number of Units Affected 9,221

Summary

Honda (American Honda Motor Co.) is recalling certain 2025 Acura MDX vehicles. The touchscreen in the center console may go blank, resulting in the rearview camera image not displaying as intended. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rear Visibility."

Remedy

Dealers will replace the center information display unit, free of charge. Owner notification letters are expected to be mailed March 3, 2025. Owners may contact Honda's customer service at 1-888-234-2138. Honda's number for this recall is RKZ.

Vehicle

MAKE	MODEL	YEAR
ACURA	MDX	2025

Inoperative Forward Collision Warning System

An inoperative forward collision warning system that does not function as intended can increase the risk of a crash.

NHTSA Campaign Number: 25V035000

Manufacturer Autocar, LLC

Components FORWARD COLLISION AVOIDANCE

Potential Number of Units Affected 2

Summary

Autocar, LLC (Autocar) is recalling certain 2023 Autocar DC (Legend) trucks. The forward collision warning (FCW) system may be inoperative due to a software error.

Remedy

Dealers will reprogram the FCW software, free of charge. Owner notification letters are expected to be mailed March 27, 2025. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is DC-2501.

Vehicle

MAKE	MODEL	YEAR
AUTOCAR	LEGEND	2023

Water Intrusion In Harness Can Shut Down EV System

A loss of drive power increases the risk of a crash.

NHTSA Campaign Number: 25V037000

Manufacturer Mitsubishi Fuso Truck of America, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 233

Summary

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain 2024 FEC7K and FEC9K trucks. The chassis harness may have been improperly sealed. Water intrusion can shut down the EV system, causing a loss of drive power.

Remedy

Dealers will repair the chassis wire harness and replace the fuse terminals as necessary, free of charge. Owner notification letters are expected to be mailed February 21, 2025. Owners may contact MFTA customer service at 1-877-711-0707. MFTA's number for this recall is C10129.

MAKE	MODEL	YEAR
MITSUBISHI FUSO	RIZON FEC7K (E16)	2024
MITSUBISHI FUSO	RIZON FEC9K (E18)	2024

Driver's Air Bag May Not Deploy/FMVSS 208

A deactivated driver's air bag will not deploy as intended, increasing the risk of injury during a crash.

NHTSA Campaign Number: 25V040000

Manufacturer Toyota Motor Engineering & Manufacturing

Components STEERING, AIR BAGS

Potential Number of Units Affected 1,716

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2023 Toyota Corolla, Corolla Cross, Corolla Cross Hybrid, Highlander, Highlander Hybrid, Tacoma, Lexus RX350, 2023-2024 NX250, and NX350 vehicles that may have been incorrectly repaired under previous NHTSA recall number 23V-480. An electrical connection inside the steering column's spiral cable assembly may be insufficiently welded, causing the connection to separate and deactivate the driver's air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will inspect and replace the spiral cable assembly as necessary, free of charge. Owner notification letters are expected to be mailed March 30, 2025. Owners may contact Toyota's customer service at 1-800-331-4331. Toyota's number for this recall is 25TA02. Lexus' number for this recall is 25LA02.

MAKE	MODEL	YEAR
LEXUS	NX	2023-2024
LEXUS	RX	2023
ТОУОТА	COROLLA	2023
ТОУОТА	COROLLA CROSS	2023
ТОУОТА	COROLLA CROSS HYBRID	2023
ТОУОТА	HIGHLANDER	2023

MAKE	MODEL	YEAR
ТОУОТА	HIGHLANDER HYBRID	2023
ТОУОТА	TACOMA	2023